




PERIODIC CLEANING OF ICE MACHINES WITH CALKLIN

SS / CD / GR




CD/GR ICE MACHINE CLEANING WITH CALKLIN

- 1** Turn off the water and the machine. Remove the rear panel.

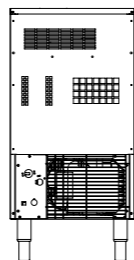

- 2** Disconnect the water inlet tube to the evaporator and the overflow tube to empty the water. Reconnect the tubes.

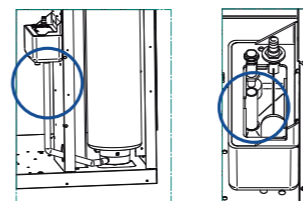


- 3** Mix Calklin product with hot water. (50gr in 1liter of water)




- 4** Disconnect the compressor.


Modular machines: remove the red output wire from the contactor to the compressor.

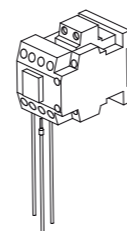

Compact machines: press the cleaning switch in mode 0.

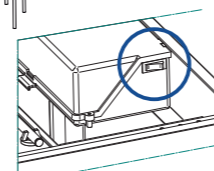

- 5** Clean the condenser with a brush.

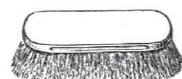

- 6** Turn on the machine and let it run for 20 minutes.


- 7** Turn off the machine and empty the water tank again as indicated in step 2.

- 8** Turn on the water and reconnect the compressor (reversing step 4).


- 9** Turn on the machine and discard the ice for the first 5 minutes.

SS ICE MACHINE CLEANING WITH CALKLIN

- 1** Turn off the water and the machine. Remove the front cover.

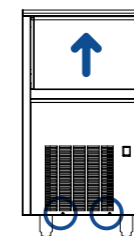


- 2** Remove the curtain and grill to access the overflow pipe. Empty the water and put the tube back.

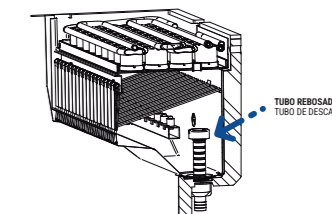


- 3** Mix Calklin product with hot water. (50gr in 1liter of water)




- 4** Press button SW3 and the main switch at the same time for a few seconds.

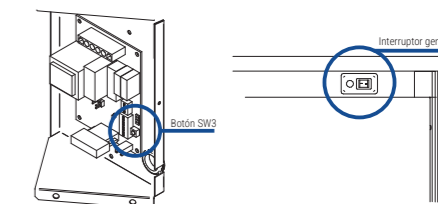

- 5** While the 20 minutes pass, clean the condenser with a brush.

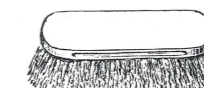

- 6** Disconnect the pump and connect it to the machine, empty the water tank (step 2) and turn on the water. Put the programmer back on takeoff.

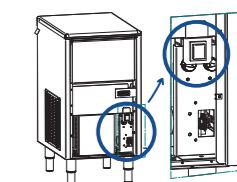

- 7** Turn on the machine and discard first ice production.

! In case the cleaning product splashes on the surface of the equipment, it is recommended to rinse it with clean water and then dry it properly.